


1 " WIDE BEAD OF DETAIL SEALANT PW OR LM-95 APPLIED TO TOP EDGE OF REPAIR PATCH AND TOOLED TO A FEATHERED EDGE - ADHESIVE OR SEALANT APPLICATION NOT REQUIRED

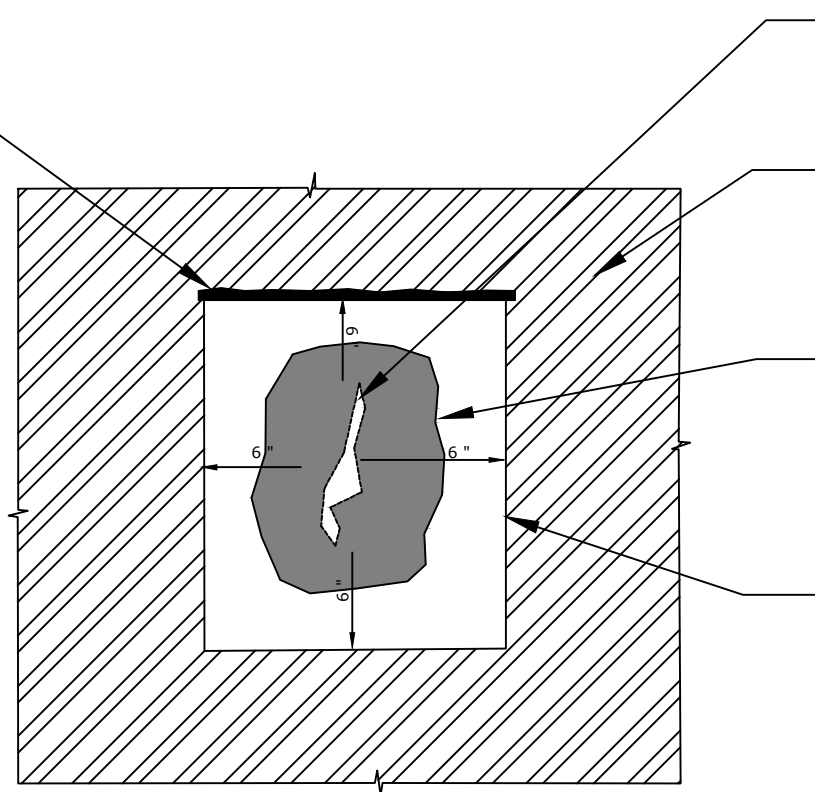

REPAIR AREA

BLINDSIDE MEMBRANE FABRIC PREPARED WITH 650 LT LIQUID ADHESIVE OR CALIFORNIA SEALANT APPLIED TO A CLEANED AREA 6" BEYOND THE DAMAGE IN ALL DIRECTIONS AT A RATE OF 50 - 75 SQ. FT. PER GALLON

MINIMUM 60 MILS OF DETAIL SEALANT PW OR LM-95 APPLIED OVER THE DAMAGE AND EXTENDED A MINIMUM OF 1" BEYOND THE DAMAGE IN ALL DIRECTIONS

FABRIC TAPE APPLIED TO SELECTED ADHESIVE OR SEALANT

FRONT VIEW @ BLINDSIDE MEMBRANE REPAIR PATCH OVER DAMAGE LESS THAN 2"

BS8

© POLYGUARD PRODUCTS, INC.